



Penetrant Professor Approved

Product Data Sheet

D-78B Water Suspendable Developer

1
10/2015



Met-L-Chek Company manufactures a complete line of developers used in the fluorescent (**Type 1**) and visible (**Type 2**) dye penetrant inspection process. All Met-L-Chek Company developers are qualified to **AMS-2644** and are sold under the **Met-L-Chek®** and **Pen-Chek®** trademarks. Met-L-Chek Company products are manufactured under license in The Netherlands by NDT Europa.

The use of a developer is required by most penetrant inspection specifications. The developer draws the penetrant from the flaw and creates a uniform surface on which to view the penetrant indication. **D-78B** is used with fluorescent (**Type 1**), and visible (**Type 2**) penetrants as a form “c” developer per **AMS-2644** and **ASTM E-1417**. This form of developer powder is dispersed in water and applied to the inspection surface after the surface penetrant has been removed and before the part is dried. This form of developer is generally applied by immersion dip, flow on, or gentle air less spray, prior to the drying process. A uniform film will form during the drying. The developer particles will settle out of solution upon standing and as such will require continuous agitation during use.


BATH PREPARATION: Use a tank that has little or no plumbing in it. The nooks and crannies in piping are a favorite place for bacteria to breed and to hide. It is difficult to get into these spots to clean them, and once they become infected they will continue to give trouble. Clean and sterilize the tank before you use it. Cleaning can be done with detergent and a brush, and many users follow this with steam cleaning. Once the tank is clean, sterilize it with swimming pool bleach, by making up the solution, filling tank, and letting it sit overnight. Drain the tank and rinse it with fresh water. This must be done to be sure that the bleach is gone. The bleach contains chlorine, which is harmful to many metals.

Weigh out the amount of developer powder that is required. **D-78B** is qualified at a concentration of **1/2 lb/gal (60 g/L)** for fluorescent penetrants and **2 lb/gal (240 g/L)** for visible penetrants. If at all possible use distilled or deionized water to minimize mineral and bacteriological problems. Agitation of the bath during make up and during use will ensure uniform dispersion of the developer powder, which will settle upon standing. Add the water to the tank, then add the powder: The solution concentration can be checked by using a hydrometer that has a range of 1.000 to 1.200. Evaporation causes the concentration to rise and this can be corrected by adding water, stirring and rechecking the hydrometer reading.

Check the solution daily for color and clearness. The solution should be milky but free of discolored objects, strings of algae or other obvious growths. This daily check is especially important if the inspection process involves the processing of baskets of parts that are made of dissimilar metals. These metals can set up an electrical current that can produce discoloration of the solution. This color change is a sign that the developer constituents are becoming contaminated and indication detection interference may be encountered. Biologically bad developer solution will absorb fluorescence causing false indications or even masking relevant indications. The growths will also begin to evolve noxious odors which makes continued use unpleasant. Biologically contaminated solutions will need to be disposed of and the tank & plumbing sterilized before making a fresh bath.

After parts have been dipped into the developer, put them immediately into the dryer. Allowing part to remain in the wet developer, or to sit while wet for a period of time before drying can cause the penetrant to bleed from the defects, resulting in dim blurry indications. Immediate drying produces the best results. The dryer temperature should be set at the maximum allowable temperature of 160°F(71°C). If the surface of the part looks bluish under ultra violet light (UV-A) , or pinkish it is an indication that the parts have been in the developer bath too long and the bath is becoming contaminated with penetrant.

D-78B developer solution

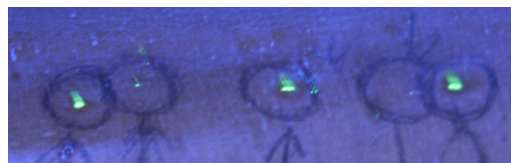

Fluorescent penetrant indication on D-78B



Penetrant Professor Approved

Product Data Sheet

2
10/2015

D-78B Water Suspendable Developer

Typical Physical Properties

Form: white coarse powder
Density: 313 g/L
Flash Point: none
Fluorescence: none
Coating: white film
Removability with water: complete
Corrosion of aluminum: none
Corrosion of carbon steel: none
Corrosion of magnesium: none
Corrosion of stainless steel: none
Corrosion of titanium: none
Chloride content: < 10000 ppm (1%)
Sulfur content: < 10000 ppm (1%)
Chromate: none
Asbestos: none
Mercury: none
VOC's: 0 g/L
Ozone layer depleting substances: none
PCB's: none

The warranty shelf life of the product is 2 years
from date of batch approval.

Specifications

AMS-2644

ASME B & PV code sec V

ASTM E-1417

AMS-2647

ASTM E-165

ISO-3452

Product Availability

10 lb.(4.5K) box

25 lb.(11.3K) box

50 lb.(22.7K) box

NSN #'s

10 lb. 6850-01-264-8684

Concentration Control @ 15.5°C (60°F)

2.00 lb/gal(240g/L) - 1.130

1.75 lb/gal(210g/L) - 1.113

1.50 lb/gal(180g/L) - 1.096

1.25 lb/gal(150g/L) - 1.080

1.00 lb/gal(120g/L) - 1.065

0.75 lb/gal(90g/L) - 1.047

0.50 lb/gal(60g/L) - 1.032

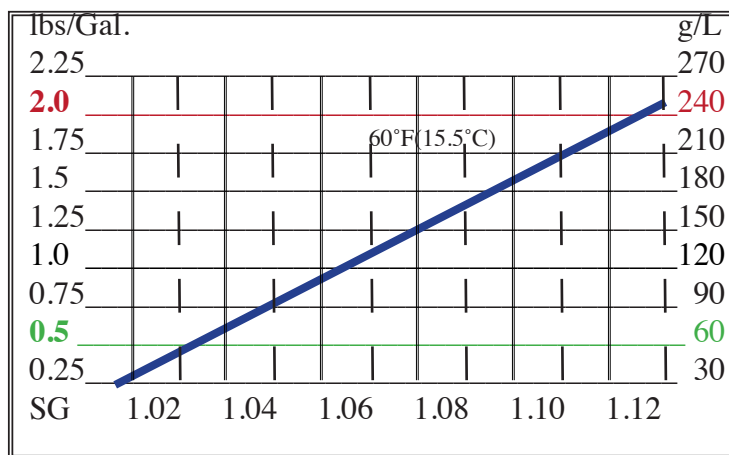


Chart is not precise and is provided as a guide only.
Specific Gravity readings are effected by tempera-
ture. For uniform comparisons make all readings at
the same temperature.

GHS Information

Warning

GHS: Hazard Statements:

H303: May be harmful if swallowed

H333: May be harmful if inhaled

GHS Precautionary Statements:

P102: Keep out of reach of children.

P233: Keep container tightly closed.

P261: Avoid breathing dust, fumes/gas/mist/vapors/spray.

P280: Wear protective glove/clothing/eye protection/face protection.

P284: In case of inadequate ventilation wear respiratory protection.



GHS Response Statements:

IF INHALED: Remove person to fresh air and keep comfortable for breathing, get medical advice/attention if you feel unwell.

IF ON SKIN: Wash with plenty of water. If skin irritation occurs, get medical advice/attention.

IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easily to do. Continue rinsing, get medical attention.

IF SWALLOWED: Rinse mouth, Do Not induce vomiting, get medical attention if feeling unwell.

IF ON CLOTHING: Take off contaminated clothing and wash before reuse.

Transport:

DOT - not regulated

IATA- not regulated

IMDG- not regulated

NDT Supply.com, Inc.

7952 Nieman Road
Lenexa, KS 66214-1560 USA

Phone: 913-685-0675, Fax: 913-685-1125
e-mail: sales@ndtsupply.com, www.ndtsupply.com

